

FEATURES


- Directly adapts to most automatic wire processing machines
- Applicator designed to industry standard mounting and shut height 135.80mm (5.346")
- Quick set-up time; plus the crimp height, track and feed adjustments can be set without removing the applicator from the press
- Fine adjustment allows users to achieve target with little effort by adjusting in increments of .015mm (.0006") for conductor crimp height and .063mm (.0025") for insulation height
- Independent adjustment rings allow users to quickly adjust the conductor or insulation crimp height without affecting each other.

SCOPE

Products: Flat Blade Crimp Terminal, 20 AWG Double Crimp applications.

Terminal	Terminal Order No	Wire Size		Insulation Di	ameter Max.	Strip Length		
Series No.		AWG	mm²	mm	ln.	mm	ln.	
1508	05-06-0117	20 + 20	0.50+ 0.50	3.55	.140	3.96-5.35	.156218	
For 16-20 AWG single wire applications 63894-1000 is recommended.								
For 14 AWG and double wire applications 63894-1100 is recommended.								

DEFINITION OF TERMS

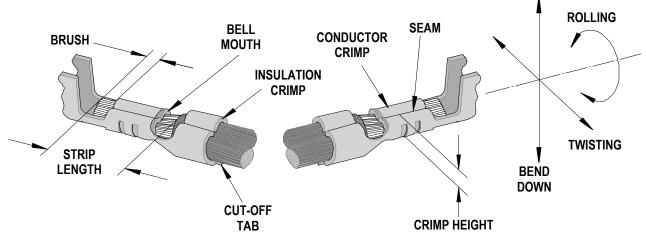

The above terminal drawing is a generic terminal representation. It is not an image of a terminal listed in the scope.

BEND UP

CRIMP SPECIFICATIONS

Terminal Series No.	Bell mouth		Cut-off Ta	ab Max.	Conductor Brush		
reminal Series No.	mm	In.	mm	In.	mm	In.	
1508							

	Bend up	Bend down	Twist	Roll	Punch Width (Ref)			
Terminal Series No.					Cond	luctor	Insul	ation
	Degree		Deg	ree	mm	In.	mm	In.
1508					2.30	.091	4.25	.167
Seam								
Seam shall not be open and no wire allowed out of the crimping area								

After crimping, the conductor profile should measure the following.

	Wire Size			Pull Force				
Terminal Series No.			Crimp Height		Crimp Wi	Minimum		
	AWG	mm ²	mm	ln.	mm	ln.	N	Lb.
1508	20 + 20	0.50+ 0.50	1.52-1.62	.060064	2.32-2.42	.091095	57.8	13.00


NOTE: Some of the specifications in these charts above are intentionally left blank due to the fact that the information does not currently exist.

Tool Qualification Notes:

- 1. Pull Force should be measured with no influence from the insulation crimp.
- 2. The above specifications are guidelines to an optimum crimp.

PARTS LIST

Mini-Mac Applicator 63894-1200								
Item	Order No Engineering No. Description							
Item Order No Engineering No. Description Quantity Perishable Tooling								
	63894-1270	63894-1270	Tool Kit (All "Y" Items)	REF				
1	11-18-5061	60811A106	Conductor Punch	1 Y				
2	11-18-4896	60804A102	Conductor Anvil	1 Y				
3	11-18-5071	60811B108	Insulation Punch	1 Y				
4	11-18-5072	60811B109	Insulation Anvil	1 Y				
5	11-18-5376	60804F144	Front Cut-Off Plunger	1 Y				
6	11-18-5375	60804F143	Front Cut-Off Plunger Retainer	1 Y				
	•	Other	Components					
7	11-18-4083	60707-8	Feed Guide	1				
8	11-18-5005	60800D112	Hold Down Block	1				
9	11-18-5006	60800D113	Spring Retainer	1				
10	11-18-5007	60800D114	Compression Spring (Hold Down)	1				
11	11-18-5064	60811A111	Anvil Mount	1				
12	11-18-5065	60811A115	Tooling Washer	1				
13	11-18-5067	60811A121	Hold Down Plunger	1				
14	11-18-5068	60811A122	Hold Down 1508 Terminal	1				
15	11-18-5114	60804A130	Scrap Deflector	1				
16	11-18-5115	60805A119	Wire Stop	1				
17	11-18-5116	60804A141	Compression Spring (Knock out)	1				
18	11-18-5374	60804F142	Knockout Blade	1				
19	11-24-1067	4996-4	Cut Off Plunger Spring	1				
20	63443-6125	63443-6125	Rear Cover	1				
21	63803-5118	63803-5118	Conductor Bushing	1				
22	63894-1101	63894-1101	Front Plunger Striker	1				
			Frame					
23	63801-3201	63801-3201	Тор	1				
24	63801-3282	63801-3282	Base	1				
25	63801-6550	63801-6550	Track	1				
		Ha	ardware					
26	N/A	N/A	M2.5 by 6 Long SHCS	1**				
27	N/A	N/A	M3 by 6 Long SHCS	4**				
28	N/A	N/A	M3 by 20 Long SHCS	2**				
29	N/A	N/A	M4 by 6 Long SHCS	1**				
30	N/A	N/A	M4 by 8 Long BHCS	2**				
31	N/A	N/A	M4 by 12 Long BHCS	2**				
32	N/A	N/A	M4 by 16 Long SHCS	2**				
33	N/A	N/A	M5 by 14 Long SHCS	1**				
34	N/A	N/A	M8 by 20 Long BHCS	1**				
** Available from an industrial supply company such as MSC (1-800-645-7270).								

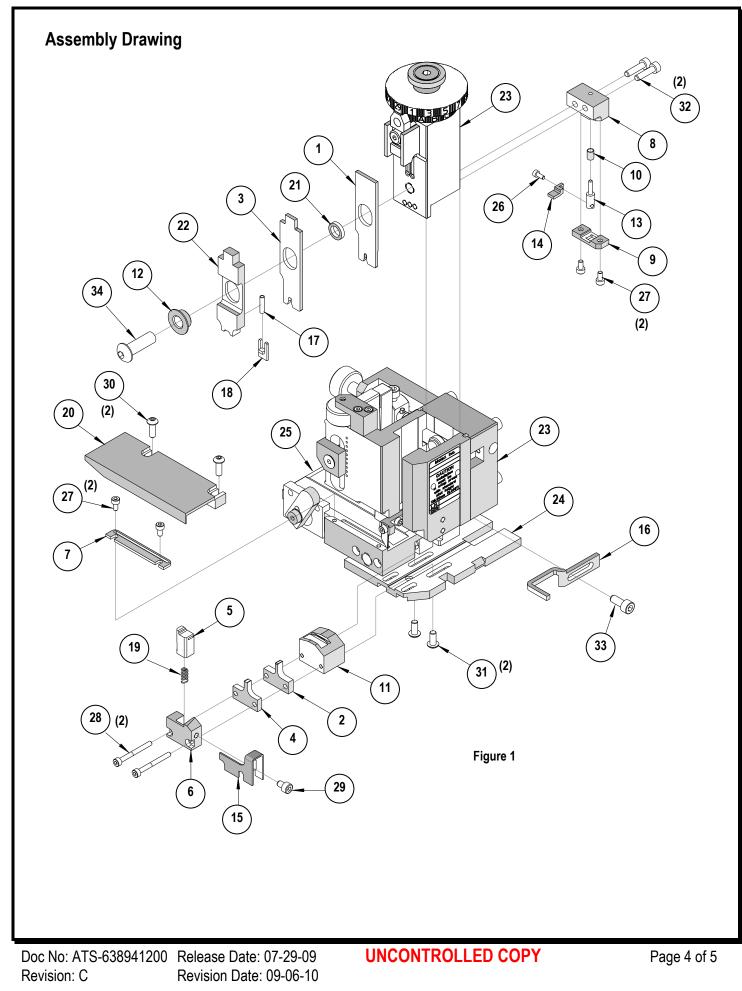

NOTES

- 1. Molex recommends an extra perishable tooling kit be maintained at your facility.
- 2. Verify tooling alignment by manually cycling the press and applicator before crimping under power. Check that all screws are tight.
- 3. Slugs, terminals, dirt, and oil should be kept clear of work area.
- 4. Wear safety glasses at all times.
- 5. For recommended maintenance refer to the Mini-Mac Manual.

CAUTION: This applicator should only be used in a press with a shut height of 135.80 mm (5.346"). Tooling damage could result at a lower setting

CAUTION: To prevent injury, never operate this applicator without the guards supplied with the press or wire-processing machine in place. Reference the press or wire processing manufacturer's instruction manual.

CAUTION: Molex crimp specifications are valid only when used with Molex terminals, applicators and tooling.

Contact Information

For more information on Molex application tooling please contact Molex at 1-800-786-6539.

http://www.molex.com